



GIMA

Gima S.p.A.

Via Marconi, 1 – 20060 Gessate (MI) Italy

gima@gimaitaly.com – export@gimaitaly.com

www.gimaitaly.com

PROFESSIONAL MEDICAL PRODUCTS

DIGITAL VETERINARY THERMOMETER

Congratulations on your purchase of the 60 Second Reliable Veterinary Digital Thermometer. This veterinary thermometer measures Rectal temperature in companion animals. When used properly, it will give you years of accurate and dependable measurements.


Please read the instructions carefully to ensure accurate temperature measurement and safe operation.

PRECAUTIONS

- Do not bend the Thermometer Tip
- Do not store thermometer in direct sunlight or at high temperature.
- Keep out of the reach of children.
- Do not drop the thermometer or expose to heavy shock.
- Do not attempt to disassemble the thermometer except to replace the battery.

This digital thermometer measures body temperature in Rectal use.


- Easy to use
- Easy to read large display
- Beeps when reaches peak temperature
- Automatic recall of last measurement reading
- Waterproof tip

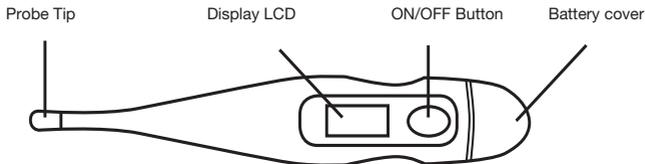

1. Remove the thermometer from the Storage Case. Press the On/Off Button to turn on the thermometer. All symbols will appear on the Display Window, indicating that the thermometer is functioning properly.
2. The thermometer will display the last measured temperature automatically indicating it is functioning proper. It is ready to measure body temperature when the display begins flashing Lo°C (Lo°F). The thermometer is pre-set to display results in °C or °F and cannot be adjusted.
3. Place the thermometer in the area to be measured following the descriptions below.

Rectal Measurement (rectum):

- Place Probe Cover over Thermometer Tip or lubricate Thermometer Tip with a water-soluble lubricant.
- Gently place the Thermometer Tip about 2-3 cm (-1") into rectum.
- Read the temperature measurement when a continuous beep sounds or the °C (°F) symbol stops flashing. This indicates that the peak temperature has been reached. Measurement time should be about 60 seconds.

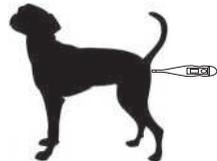

Note:


- If any resistance is detected when inserting tip into rectum, STOP and do not force.
- Average normal temperature: 38.5°C (99.6°F)

Note:

- If display shows “Lo”, the measured temperature is below 32.0°C (89.6°F).
 - If display shows “Hi”, the measured temperature is above 42.9°C (109.2°F).
4. Press the On/Off Button to turn off the thermometer. The measurement taken will automatically be stored in memory. The thermometer will automatically shut off after 8 minutes if the thermometer is not turned off.

STORAGE

- Keep the thermometer in the Storage Case when not in use.
- Do not leave the thermometer in direct sunlight or near heat sources.

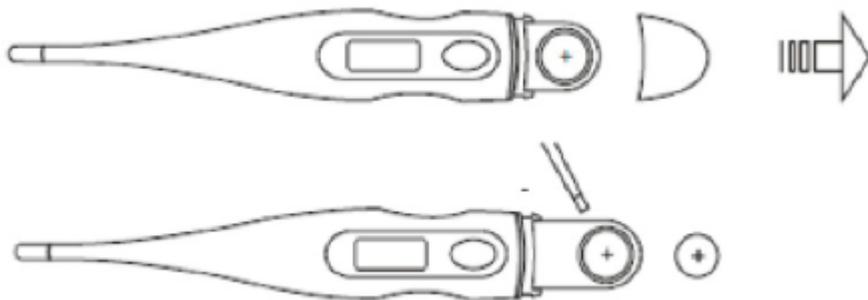REPLACING THE BATTERY

With normal use, the battery will last for approximately 1000 uses or 2 years. When the battery needs to be replaced, a battery symbol  will be displayed. To replace the battery:

- Push the symbol down on the back side of the thermometer, and pull off the Battery Cover exposing the battery. (Use Screwdriver to unscrew the cover screw)
- Use the suitable tool to push out the old battery.
- Insert the new battery into the battery holder, making sure the positive (+) side is facing upward.

Note:

- Do not swallow or eat the battery.
- Follow proper precautions and all local regulations when disposing of the thermometer and used batteries.
- Keep battery out of the reach of children.

SPECIFICATIONS Feature	Technical Specification
Measuring Time	60±20 seconds (Rectal)
Beep	When thermometer is turned on and after completion of measurement
Measurement Range	32°C~42.9°C (89.6°F~109.22°F)
Measurement Accuracy	±0.1°C (±0.2°F)
Resolution	0.1°C (0.1°F)
Memory	Last memory recall
Automatic Shut Off	After about 5 minutes
Display	3 digit LCD display
Operating Temperature	10~42.9°C (50~109.2°F)
Storage Temperature	-10~60°C (14~140°F)
Operating/Storage Relative Humidity	10~95% RH
Waterproof	At tip area
Battery and Battery Life	1.5V AG3 (LR41) battery; about 1000 uses or 2 years battery life
Thermometer Dimensions	138x210x10mm
Thermometer Weight	12g (including battery)

CLEANING

Clean Thermometer Tip area only with a damp cloth before and after each use using Isopropyl Alcohol. Be sure to dry thermometer thoroughly after cleaning and prior to use.

Note: only the Thermometer Tip area is water-resistant.

REF 80450 / KDV-02



Kellyunion Electronics Co., Ltd
 No. 114, Five Star Village, Jiangkou Town
 Hanjiang District 3511115 Putian, Fujian
 PEOPLE'S REPUBLIC OF CHINA
 Made in China



Landlink GmbH
 Dorfstrasse 2/4, Emmendingen,
 79312 Germany

